

SELLER'S DISCLOSURE NOTICE

©Texas Association of REALTORS®, Inc. 2022

Section 5.008, Property Code requires a seller of residential property of not more than one dwelling unit to deliver a Seller's Disclosure Notice to a buyer on or before the effective date of a contract. This form complies with and contains additional disclosures which exceed the minimum disclosures required by the Code.

exceed the minimum disc	losı	ıres	s rec	quir	ed by	y the	Code.	-							
CONCERNING THE P	PRC	PE	ERT	ΥA	AT <u>2</u>	Gloc	comorra Lane, Hillt	op Lal	ces,	TX 7	78	871			_
AS OF THE DATE S	SIG SUY	NE ER	D R MA	BY 4Y	SE WIS	LLE 3H T	R AND IS NOT O OBTAIN. IT I	T A S	SUI	BST	Ī	HE CONDITION OF THE PROTUTE FOR ANY INSPECTION RRANTY OF ANY KIND BY S	NS	C	R
Seller ☐ is ☑ is not the Property? ☑ Janua Property				ng	the	Prop						r), how long since Seller has c date) or			
												, No (N), or Unknown (U).) ermine which items will & will not o	conv	⁄ey.	
Item	Υ	Ν	U		Iten	า		Υ	Ν	U		Item	Υ	Ν	U
Cable TV Wiring					Nat	ural	Gas Lines					Pump: ☐ sump ☐ grinder		\mathbf{V}	
Carbon Monoxide Det.	abla				Fue	l Ga	s Piping:	V				Rain Gutters	\checkmark		
Ceiling Fans	abla			_			ron Pipe	V				Range/Stove	\checkmark		
Cooktop	abla				-Co	ppe	ŗ	V				Roof/Attic Vents		\mathbf{V}	
Dishwasher	\square					_	ated Stainless ubing		\square			Sauna		V	
Disposal		\mathbf{V}			Hot	Tub)		\mathbf{V}			Smoke Detector	\mathbf{A}		
Emergency Escape Ladder(s)		☑			Intercom System				\square			Smoke Detector – Hearing Impaired		V	
Exhaust Fans	abla				Mic	rowa	ave	∇				Spa		\mathbf{V}	
Fences		\square			Out	doo	r Grill		\mathbf{A}			Trash Compactor		\mathbf{V}	
Fire Detection Equip.	\mathbf{V}				Pati	o/D	ecking	V				TV Antenna		\mathbf{V}	
French Drain		\mathbf{V}			Plur	nbir	ig System	∇				Washer/Dryer Hookup	\mathbf{V}		
Gas Fixtures	\mathbf{V}				Pool							Window Screens	\mathbf{V}		
Liquid Propane Gas:	\mathbf{V}				Pool Equipment				\mathbf{V}			Public Sewer System	\land		
-LP Community (Captive)		☑			Pool Maint. Accessories				abla						
-LP on Property	\square				Pool Heater				∇						
					1	1									
ltem					N		Addition								
Central A/C							☑ electric ☐ g		nu	mbe	er	of units:			
Evaporative Coolers							number of units								
Wall/Window AC Units	5						number of units								
Attic Fan(s) Central Heat							if yes, describe:		nu	mha	r	of units:			
Other Heat				\square			□ electric □ g	as	Hu	HIDE	 	or units.			
				∇											
Carport															
Garage				-			□ attached □								
Garage Door Openers			∇	분	분	number of units		ual	JI 10		number of remotes:			-	
Satellite Dish & Controls					무	owned le		fro	m		idiliboi di lollidica.			_	
Security System							ased ased								
			_:4: '					1			_	040	4		 ,
(TXR-1406) 07-10-23 Initialed by: Buyer:and Seller:,,															

Improvements encroaching on others' property Active infestation of termites or other wood \checkmark \checkmark destroying insects (WDI) \leq Previous treatment for termites or WDI Located in Historic District \checkmark Previous termite or WDI damage repaired Historic Property Designation \checkmark \checkmark **Previous Foundation Repairs** \checkmark **Previous Fires** \checkmark and Seller: (TXR-1406) 07-10-23 Initialed by: Buyer: Page 2 of 7

Keller Williams - Brazos Valley

2801 Earl Rudder College Station, TX 77845

979-693-9100

William Hartmann

Concerning the Property at 2 Gloccomorra Lane, Hilltop Lakes, TX 77871

Previous Roof Repairs			\checkmark	Termite or WDI damage needing repair □ ☑		
Previous Other Structural Repairs				Ø	Single Blockable Main Drain in Pool/Hot ☐ ☑ ☐ ☐	
Previous Use of Premises for Manufacture of Methamphetamine				Ø		
If t	he ans	swer to any of the items in Section 3 is y	yes,	exp	plain (attach additional sheets if necessary):	
	*A sin	gle blockable main drain may cause a suction er	ntrap	men	t hazard for an individual.	
of	repai	r, which has not been previously dis	clos	sed	ment, or system in or on the Property that is in need in this notice? ☐ yes ☑ no If yes, explain (attach	
		5. Are you (Seller) aware of any of th holly or partly as applicable. Mark N			wing conditions?* (Mark Yes (Y) if you are aware and you are not aware.)	
<u>Y</u>	<u>N</u>	Present flood insurance coverage.				
	□ ☑ Previous flooding due to a failure or breach of a reservoir or a controlled or emergency release water from a reservoir.				of a reservoir or a controlled or emergency release of	
	abla	☑ Previous flooding due to a natural flood event.				
	-					
	Located □ wholly □ partly in a 100-year floodplain (Special Flood Hazard Area-Zone A, V, A99, AE, AO, AH, VE, or AR).					
☐ ☑ Located ☐ wholly ☐ partly in a 500-ye			ar fl	ood	lplain (Moderate Flood Hazard Area-Zone X (shaded)).	
	abla	Located ☐ wholly ☐ partly in a floodw	ay.			
		Located ☐ wholly ☐ partly in a flood p	ool.			
	abla	Located ☐ wholly ☐ partly in a reserve	oir.			
lf t	he ans	swer to any of the above is yes, explain		ach	additional sheets as necessary):	
			Зиує	er m	ay consult Information About Flood Hazards (TXR 1414).	
	•	purposes of this notice:				
	which	is designated as Zone A, V, A99, AE, AO, AH	i, VE	, or	tified on the flood insurance rate map as a special flood hazard area, AR on the map; (B) has a one percent annual chance of flooding, nclude a regulatory floodway, flood pool, or reservoir.	
					ntified on the flood insurance rate map as a moderate flood hazard nd (B) has a two-tenths of one percent annual chance of flooding,	
"Flood pool" means the area adjacent to a reservoir that lie subject to controlled inundation under the management of t					pove the normal maximum operating level of the reservoir and that is United States Army Corps of Engineers.	

(TXR-1406) 07-10-23

Initialed by: Buyer: and Seller:

97/25/24 8:01 AM CDT dotloop verified

Page 3 of 7

"Flood insurance rate map" means the most recent flood hazard map published by the Federal Emergency Management Agency under the National Flood Insurance Act of 1968 (42 U.S.C. Section 4001 et seq.).

"Floodway" means an area that is identified on the flood insurance rate map as a regulatory floodway, which includes the channel of a river or other watercourse and the adjacent land areas that must be reserved for the discharge of a base flood, also referred to as a 100-year flood, without cumulatively increasing the water surface elevation more than a designated height.

"Reservoir" means a water impoundment project operated by the United States Army Corps of Engineers that is intended to retain water or delay the runoff of water in a designated surface area of land.

Section 6. Have you (Seller) ever filed a claim for flood damage to the Property with any insurance provider, including the National Flood Insurance Program (NFIP)?* ☐ yes ☑ no If yes, explain (attach additional sheets as necessary):					
*Homes in high risk flood zones with mortgages from federally regulated or insured lenders are required to have flood insured Even when not required, the Federal Emergency Management Agency (FEMA) encourages homeowners in high risk, morisk, and low risk flood zones to purchase flood insurance that covers the structure(s) and the personal property with structure(s). Section 7. Have you (Seller) ever received assistance from FEMA or the U.S. Small Busin Administration (SBA) for flood damage to the Property? yes no If yes, explain (attach additional sheets as necessary):	iness				
Section 8. Are you (Seller) aware of any of the following? (Mark Yes (Y) if you are aware. Mark N if you are not aware.)	lo (N)				
Y N □ □ □ Room additions, structural modifications, or other alterations or repairs made without nece permits, with unresolved permits, or not in compliance with building codes in effect at the time.	ssary				
Homeowners' associations or maintenance fees or assessments. If yes, complete the following: Name of association: Hilltop Lakes POA Manager's name: Phone: 936-855-2222 Fees or assessments are: \$1560.00 per year and are: Image: mandatory volume and unpaid fees or assessment for the Property? yes (\$) In our of the Property is in more than one association, provide information about the other association below or attach information to this notice.	ntary ations				
 Any common area (facilities such as pools, tennis courts, walkways, or other) co-owned in undi interest with others. If yes, complete the following: Any optional user fees for common facilities charged? □ yes ☑ no If yes, describe:					
☐ ☑ Any notices of violations of deed restrictions or governmental ordinances affecting the conditi use of the Property.	on or				
☐ ☑ Any lawsuits or other legal proceedings directly or indirectly affecting the Property. (Includes, not limited to: divorce, foreclosure, heirship, bankruptcy, and taxes.)	but is				
☐ ☑ Any death on the Property except for those deaths caused by: natural causes, suicide, or accounted to the condition of the Property.	cident				
☐ ☑ Any condition on the Property which materially affects the health or safety of an individual.					
Any repairs or treatments, other than routine maintenance, made to the Property to reme environmental hazards such as asbestos, radon, lead-based paint, urea-formaldehyde, or mold. If yes, attach any certificates or other documentation identifying the extent of the remediation (for example, certificate of mold remediation or other remediation).	ediate				
Any rainwater harvesting system located on the Property that is larger than 500 gallons and that a public water supply as an auxiliary water source.					
(TXR-1406) 07-10-23 Initialed by: Buyer: and Seller: a					

Keller Williams - Brazos Valley

dotloop signature verification: dtlp.us/MwoB-9FWJ-0wpx

2801 Earl Rudder College Station, TX 77845

979-693-9100

William Hartmann

Seller acknowledges that the statements in this notice are true to the best of Seller's belief and that no person, including the broker(s), has instructed or influenced Seller to provide inaccurate information or to omit any material information.

Ryan Joseph Pate	dotloop verified 07/25/24 8:01 AM CDT DCDH-NUFN-RUM0-YCVH		
Signature of Seller	Date	Signature of Seller	Date
Printed Name: Ryan Joseph Pate		Printed Name: Ryan Joseph Pate	

ADDITIONAL NOTICES TO BUYER:

- (1) The Texas Department of Public Safety maintains a database that the public may search, at no cost, to determine if registered sex offenders are located in certain zip code areas. To search the database, visit https://publicsite.dps.texas.gov. For information concerning past criminal activity in certain areas or neighborhoods, contact the local police department.
- (2) If the Property is located in a coastal area that is seaward of the Gulf Intracoastal Waterway or within 1,000 feet of the mean high tide bordering the Gulf of Mexico, the Property may be subject to the Open Beaches Act or the Dune Protection Act (Chapter 61 or 63, Natural Resources Code, respectively) and a beachfront construction certificate or dune protection permit may be required for repairs or improvements. Contact the local government with ordinance authority over construction adjacent to public beaches for more information.
- (3) If the Property is located in a seacoast territory of this state designated as a catastrophe area by the Commissioner of the Texas Department of Insurance, the Property may be subject to additional requirements to obtain or continue windstorm and hail insurance. A certificate of compliance may be required for repairs or improvements to the Property. For more information, please review *Information Regarding Windstorm and Hail Insurance for Certain Properties* (TXR 2518) and contact the Texas Department of Insurance or the Texas Windstorm Insurance Association.
- (4) This Property may be located near a military installation and may be affected by high noise or air installation compatible use zones or other operations. Information relating to high noise and compatible use zones is available in the most recent Air Installation Compatible Use Zone Study or Joint Land Use Study prepared for a military installation and may be accessed on the Internet website of the military installation and of the county and any municipality in which the military installation is located.
- (5) If you are basing your offers on square footage, measurements, or boundaries, you should have those items independently measured to verify any reported information.
- (6) The following providers currently provide service to the Property:

Electric: Navasota Valley Electric Cooperative	phone #:903-828-3232			
Sewer:Hilltop Lakes	phone #:936-855-2222			
Water: Hilltop Lakes	phone #: <u>936-855-2995</u>			
Cable:	phone #:			
Trash: Hilltop Lakes	phone #: <u>936-855-2222</u>			
Natural Gas:	phone #:			
Phone Company:	phone #:			
Propane: Leon Gas Company	phone #: <u>936-396-3921</u>			
Internet:Windstream	phone #: ₈₀₀₋₃₄₇₋₁₉₉₁			

(TXR-1406) 07-10-23

Initialed by: Buyer:

and Seller:

07/25/24 8:01 AM CDT

Page 6 of 7

Keller Williams - Brazos Valley

2801 Earl Rudder College Station, TX 77845

979-693-9100

William Hartmann

this notice as true and correct and	have no reaso	eller as of the date signed. The brokers he on to believe it to be false or inaccurate. UR CHOICE INSPECT THE PROPERTY.	
The undersigned Buyer acknowledges re	eceipt of the for	egoing notice.	
Signature of Buyer	Date	Signature of Buyer	Date
Printed Name:		Printed Name	

(TXR-1406) 07-10-23

Initialed by: Buyer:

and Seller:

RJP 07/25/24 8:01 AM CDT



Inspection Report

RYAN PATE CYLEIGH HOLLIDAY

Property Address: 2 GLOCCOMORRA LANE HILL TOP LAKES TX 77871



Tucker Inspections

Tom Rike TREC 20478 P.O. Box 10623 College Station, TX 77842 979.690.7211

PROPERTY INSPECTION REPORT

Prepared For:	epared For: RYAN PATE, CYLEIGH HOLLIDAY (Name of Client)						
Concerning:	2 GLOCCOMORRA LANE, HILL TOP LAKES, TX 77871						
	(Address or Other Identification of Inspected Property)						
Ву:	Tom Rike TREC 20478 / Tucker Inspections	9/22/2021					
	(Name and License Number of Inspector)		(Date)	=			
	(Name, License Number of Sponsoring Inspe	ector)		-			

PURPOSE, LIMITATIONS AND INSPECTOR / CLIENT RESPONSIBILITIES

This property inspection report may include an inspection agreement (contract), addenda, and other information related to property conditions. If any item or comment is unclear, you should ask the inspector to clarify the findings. It is important that you carefully read ALL of this information.

This inspection is subject to the rules ("Rules") of the Texas Real Estate Commission ("TREC"), which can be found at www.trec.texas.gov.

The TREC Standards of Practice (Sections 535.227-535.233 of the Rules) are the minimum standard for inspections by TREC Licensed inspectors. An inspection addresses only those components and conditions that are present, visible, and accessible at the time of the inspection. While there may be other parts, components or systems present, only those items specifically noted as being inspected were inspected. The inspector is NOT required to turn on decommissioned equipment, systems, utility services or apply an open flame or light a pilot to operate any appliance. The inspector is NOT required to climb over obstacles, move furnishings or stored items. The inspection report may address issues that are code-based or may refer to a particular code; however, this is NOT a code compliance inspection and does NOT verify compliance with manufacturer's installation instructions. The inspection does NOT imply insurability or warrantability of the structure or its components. Although some safety issues may be addressed in this report, this inspection is NOT a safety/code inspection, and the inspector is NOT required to identify all potential hazards.

In this report, the inspector shall indicate, by checking the appropriate boxes on the form, whether each item was inspected, not inspected, not present or deficient and explain the findings in the corresponding section in the body of the report form. The inspector must check the Deficient (D) box if a condition exists that adversely and materially affects the performance of a system or component or constitutes a hazard to life, limb or property as specified by the TREC Standards of Practice. General deficiencies include inoperability, material distress, water penetration, damage, deterioration, missing components, and unsuitable installation. Comments may be provided by the inspector whether or not an item is deemed deficient. The inspector is not required to prioritize or emphasize the importance of one deficiency over another.

Some items reported may be considered life-safety upgrades to the property. For more information, refer to Texas Real Estate Consumer Notice Concerning Recognized Hazards or Deficiencies below.

THIS PROPERTY INSPECTION IS NOT A TECHNICALLY EXHAUSTIVE INSPECTION OF THE STRUCTURE, SYSTEMS OR COMPONENTS. The inspection may not reveal all deficiencies. A real estate inspection helps to reduce some of the risk involved in purchasing a home, but it cannot eliminate these risks, nor can the inspection anticipate future events or changes in performance due to changes in use or occupancy. It is recommended that you obtain as much information as is available about this property, including any seller's disclosures, previous inspection reports, engineering reports, building/remodeling permits, and reports performed for or by relocation companies, municipal inspection departments, lenders, insurers, and appraisers.

Promulgated by the Texas Real Estate Commission(TREC) P.O. Box 12188, Austin, TX 78711-2188 (512)936-3000 (http://www.trec.state.tx.us).

You should also attempt to determine whether repairs, renovation, remodeling, additions, or other such activities have taken place at this property. It is not the inspector's responsibility to confirm that information obtained from these sources is complete or accurate or that this inspection is consistent with the opinions expressed in previous or future reports.

ITEMS IDENTIFIED IN THE REPORT DO NOT OBLIGATE ANY PARTY TO MAKE REPAIRS OR TAKE OTHER ACTIONS, NOR IS THE PURCHASER REQUIRED TO REQUEST THAT THE SELLER TAKE ANY ACTION. When a deficiency is reported, it is the client's responsibility to obtain further evaluations and/or cost estimates from qualified service professionals. Any such follow-up should take place prior to the expiration of any time limitations such as option periods.

Evaluations by qualified tradesmen may lead to the discovery of additional deficiencies which may involve additional repair costs. Failure to address deficiencies or comments noted in this report may lead to further damage of the structure or systems and add to the original repair costs. The inspector is not required to provide follow-up services to verify that proper repairs have been made.

Property conditions change with time and use. For example, mechanical devices can fail at any time, plumbing gaskets and seals may crack if the appliance or plumbing fixture is not used often, roof leaks can occur at any time regardless of the apparent condition of the roof, and the performance of the structure and the systems may change due to changes in use or occupancy, effects of weather, etc. These changes or repairs made to the structure after the inspection may render information contained herein obsolete or invalid. This report is provided for the specific benefit of the client named above and is based on observations at the time of the inspection. If you did not hire the inspector yourself, reliance on this report may provide incomplete or outdated information. Repairs, professional opinions or additional inspection reports may affect the meaning of the information in this report. It is recommended that you hire a licensed inspector to perform an inspection to meet your specific needs and to provide you with current information concerning this property.

TEXAS REAL ESTATE CONSUMER NOTICE CONCERNING HAZARDS OR DEFICIENCIES

Each year, Texans sustain property damage and are injured by accidents in the home. While some accidents may not be avoidable, many other accidents, injuries, and deaths may be avoided through the identification and repair of certain hazardous conditions. Examples of such hazards include:

- malfunctioning, improperly installed, or missing ground fault circuit protection (GFCI) devices for electrical receptacles in garages, bathrooms, kitchens, and exterior areas;
- malfunctioning arc fault protection (AFCI) devices;
- ordinary glass in locations where modern construction techniques call for safety glass;
- malfunctioning or lack of fire safety features such as smoke alarms, fire-rated doors in certain locations, and functional emergency escape and rescue openings in bedrooms;
- malfunctioning carbon monoxide alarms;
- · excessive spacing between balusters on stairways and porches;
- · improperly installed appliances;
- · improperly installed or defective safety devices;
- · lack of electrical bonding and grounding; and
- lack of bonding on gas piping, including corrugated stainless steel tubing (CSST).

To ensure that consumers are informed of hazards such as these, the Texas Real Estate Commission (TREC) has adopted Standards of Practice requiring licensed inspectors to report these conditions as "Deficient" when performing an inspection for a buyer or seller, if they can be reasonably determined.

These conditions may not have violated building codes or common practices at the time of the construction of the home, or they may have been "grandfathered" because they were present prior to the adoption of codes prohibiting such conditions. While the TREC Standards of Practice do not require inspectors to perform a code compliance inspection, TREC considers the potential for injury or property loss from the hazards addressed in the Standards of Practice to be significant enough to warrant this notice.

Contract forms developed by TREC for use by its real estate licensees also inform the buyer of the right to have the home inspected and can provide an option clause permitting the buyer to terminate the contract within a specified time. Neither the Standards of Practice nor the TREC contract forms require a seller to remedy conditions revealed by an inspection. The decision to correct a hazard or any deficiency identified in an inspection report is left to the parties to the contract for the sale or purchase of the home.

INFORMATION INCLUDED UNDER "ADDITIONAL INFORMATION PROVIDED BY INSPECTOR", OR PROVIDED AS AN ATTACHMENT WITH THE STANDARD FORM, IS NOT REQUIRED BY THE COMMISSION AND MAY CONTAIN CONTRACTUAL TERMS BETWEEN THE INSPECTOR AND YOU, AS THE CLIENT. THE COMMISSION DOES NOT REGULATE CONTRACTUAL TERMS BETWEEN PARTIES. IF YOU DO NOT UNDERSTAND THE EFFECT OF ANY CONTRACTUAL TERM CONTAINED IN THIS SECTION OR ANY ATTACHMENTS, CONSULT AN ATTORNEY.

ADDITIONAL INFORMATION PROVIDED BY INSPECTOR:

Radon Test:

Standards of Practice: Type of building: In Attendance:

TREC Texas Real Estate Commission Single Family (1 story) Customer and their agent

Rain in last 3 days:

Approximate age of building: Temperature: Weather:

Over 25 Years Over 65 (F) = 18 (C) Cloudy

Damp Yes No

Water Test:

Ground/Soil surface condition:

No

I = Inspected NI = Not Inspected NP = Not Present D = Deficient

I NI NP D

I. STRUCTURAL SYSTEMS

☑ □ □ □ A. Foundations

Type of Foundation (s): Slab on Grade

Comments:

This foundation was performing as intended at the time of this inspection. Only shows signs of typical movement due to the soil in our area. Maintaining constant moisture levels around the foundation can help keep some types of movement to a minimum.

The sunroom was an enclosed porch.

There was evidence of efflorescence in the garage. This means the garage floor may sweat at times. Be careful when walking on slipper surfaces. Be mindful of stored items in the garage as they may be subject to moisture.



A. Item 1(Picture)

□ □ □ ■ B. Grading and Drainage

Comments:

The soil is high along several areas of the foundation. It is recommended that at least three to four inches of slab is visible above the height of the grass or flower beds. Lack of slab exposure can lead to water and insect problems.

The foliage needs to be trimmed away from the structure.

Note: Recommend splash pads below the gutter downspouts to avoid erosion.

The gutters need to be cleaned out.

NI = Not Inspected

NP = Not Present

D = Deficient

NI NP D



TRIM FOLIAGE

B. Item 1(Picture)

B. Item 2(Picture)





B. Item 3(Picture)

B. Item 4(Picture)





B. Item 5(Picture)

B. Item 6(Picture)

☑ □ □ □ C. Roof Covering Materials

Types of Roof Covering: Composition Shingles

Viewed from: Walked roof

Roof Ventilation: Ridge vents, Soffit Vents, Turbines

Comments:

This is a composition shingled roof that was found in good condition at the time of this inspection.

NI NP D

NOTE: Section 535.228. sub section C. Under the Current Texas Real Estate Commission Standards of Practice the inspector is not required to determine life expectancy of the roof covering. Not required to identify latent hail damage. Not required to determine if the roof can be insured.





C. Item 1(Picture)

C. Item 2(Picture)



C. Item 3(Picture)

□ □ □ ☑ D. Roof Structures & Attics

Comments:

The attic framing in this home is typical for the era of its construction. It lacks enough bracing to meet current building standards. However, the framing still appears to be performing as intended with only signs of minor rafter deflection.

There was adequate insulation and ventilation present.

Recommend sistering (bracing) the rafters to the beams that have separated more than 1". These rafters have been sistered previously. It is this inspectors opinion with the lack of excessive settling evidence, the rafters were separated when the ridge vent was added.

NI = Not Inspected

NP = Not Present

D = Deficient

I NI NP D



D. Item 1(Picture)

D. Item 2(Picture)



D. Item 3(Picture)

□ □ □ ▼ E. Walls (Interior and Exterior)

Comments:

There was exterior trim decay in multiple areas around the unit.

There was loose/damaged vinyl siding in multiple areas around the unit.

There were moisture stains/decay along the base of the sunroom wall.

There were moisture stains along the base of the garage workroom wall.

Note: There was not a gap were the siding meets the roof. I am not able to visually see if flashing was installed. *This would not meet current building standards.*

There was peeling wall paper throughout the unit.

NI = Not Inspected

NP = Not Present

D = Deficient

I NI NP D



DAMAGED SIDING

E. Item 1(Picture)



E. Item 2(Picture)



E. Item 3(Picture)



E. Item 4(Picture)



E. Item 5(Picture)

E. Item 6(Picture)

NI = Not Inspected


NP = Not Present

D = Deficient

I NI NP D



E. Item 7(Picture)

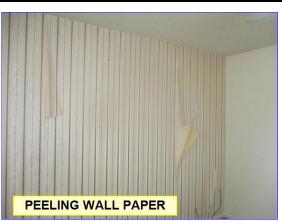

E. Item 8(Picture)



E. Item 9(Picture)



E. Item 10(Picture)

☑ □ □ □ F. Ceilings and Floors

Comments:

The floors were found in acceptable condition at the time of this inspection.

The ceilings were found in acceptable condition at the time of this inspection.

☐ ☐ ☐ ☑ G. Doors (Interior and Exterior)

Comments:

The overhead garage door weather strip was torn/missing.

There was decay along the base of the garage workroom doors.

Note: The master bathroom door does not close to the jamb.

Note: There were multiple doors that rub the carpet when opening/closing. This makes it difficult to operate the doors.

I NINP D



MASTER BATH DOOR NO CLOSE TO JAMB

G. Item 1(Picture)

G. Item 2(Picture)



G. Item 3(Picture)

☑ □ □ □ H. Stairways (Interior and Exterior)

Comments:

All components were found in satisfactory condition at the time of this inspection.

□ □ □ **I**. Windows

Comments:

These are double pane insulated glass units. They were operational at the time of this inspection.

Screens: (3) Missing

Windows with broken seals: (20) Windows marked with blue tape. Included in the count was the garage rear window that was cracked.

The master bedroom windows were 44" or higher from the floor. This would not meet current building standards for Egress. Egress is the ability to escape directly from a bedroom to the outside in the event of a fire.

TREC standards of practice state an inspector only has to identify "insulated windows that are obviously fogged or display other evidence of broken seals." Tucker Inspections marks those windows found by the inspector to be broken or have bad seals with a blue piece of tape on the window during the course of the

I = Inspected NI = Not Inspected NP = Not Present D = Deficient

NI NP D

inspection. As a buyer it is recommended that you retain a company that can check all windows and give you a price to repair units found deficient. **Tucker inspections does not guarantee that all windows** with bad seals will be identified at the time of this inspection. We identify them the best we can.



I. Item 1(Picture)

□ □ □ ▼ J. Fireplaces and Chimneys

Chimney (exterior): Brick **Operable Fireplaces:** One

Types of Fireplaces: Conventional

Comments:

This is a conventional unit that was found in acceptable condition at the time of this inspection.

There was not a damper blocker installed at the time of this inspection.

Current building standards require a damper blocker when gas logs are installed. This is a clamp or screw that prevents the damper from closing 100% to allow gas to escape in the event of a leak.

There was not a gas shut off valve near the gas log unit. I was not able to operate the gas logs at the time of this inspection.

□ □ □ ▼ K. Porches, Balconies, Decks and Carports

Comments:

The rear gazebo was in average/poor condition and in need of repair.

I NI NP D



K. Item 1(Picture)

I NI NP D

II. ELECTRICAL SYSTEMS

□ □ □ ■ A. Service Entrance and Panels

Electrical Service Conductors: Overhead service

Panel Type: Circuit breakers

Panel Capacity: No main Breaker

Electric Panel Manufacturer: Square D

Comments:

All components were found in satisfactory condition at the time of this inspection. The panel was labeled and located in the utility room.

There was not a main breaker present. This would not meet current building standards.

The main wire feed was double lugged. This is a safety hazard. Recommend further review by a professional electrician.


Note: The ground and bond wires were not separated on separate bars. Although common when this home was built, this would not meet current building standards.



A. Item 1(Picture)



A. Item 2(Picture)

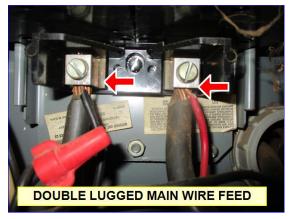

A. Item 3(Picture)



A. Item 4(Picture)

NI NP D

□ □ □ ☑ B. Branch Circuits, Connected Devices, and Fixtures

Type of Wiring: Romex

Branch wire 15 and 20 amperage: Copper

Comments:

Not all of the bedrooms had a smoke detector present. Recommend installing detectors for safety.

There was not a labeled carbon monoxide detector outside of the sleeping areas.

Current building standards require a carbon monoxide detector to be installed outside all sleeping areas, in accordance with the manufacturer's installation instructions, in any home containing fuel-burning appliances or with an attached garage. Homeowners should consider installing CO detectors for safety. Ref 2009 IRC 315.

There were no fire protective covers over the closet light bulbs. *This would not meet current building standards.*

Current building standards require romex wire, that is not located in an attic, to be covered or in a conduit.

I am not able to operate exterior lights on solar sensor during the day,.

The dining room fan was not balanced. This means the unit wobbles when operating.

The doorbell was not operating at the time of this inspection.

There was not ground fault protected outlets in the required areas. This includes the exterior, kitchen, garage and bathrooms. Exception: The master bathroom outlet was GFCI.

Note: The garage ceiling fan was disconnected.



B. Item 1(Picture)

I NI NP D

III. HEATING, VENTILATION AND AIR CONDITIONING SYSTEMS

□ □ □ ■ A. Heating Equipment

Type of Systems: Forced Air Energy Sources: Propane Heat System Brand: York

Number of Heat Systems (excluding wood): One

Comments:

This unit was functioning properly at the time of this inspection.

The flexible gas line was run into the interior of the furnace. This is not allowed under current building standards. A piece of hard line gas pipe should have been used to enter the unit.

Smooth copper pipe was used to supply gas to the unit. This is no longer allowed as it is a safety hazard.

Note: We can only visually inspect the inside of this unit. For a in-depth inspection a HVAC professional is recommended.



A. Item 1(Picture)



A. Item 2(Picture)



A. Item 3(Picture)

I = Inspected NI = Not Inspected NP = Not Present D = Deficient

I NI NP D

□ □ □ ■ B. Cooling Equipment

Type of Systems: Central Air Condition Unit

Central Air Manufacturer: Payne

Comments:

The unit was operating at the time of the inspection. The degree differential between the register and return air should be between 15-20 degrees.

The differential was less than 15 degrees at the time of this inspection. **Recommend further review by a professional HVAC contactor.**

The T stat was difficult to operate and needs to be replaced.

The primary drain line is not insulated. This would not meet current building standards.

There are no locking cap valves on the Freon line on the exterior unit.

Note: We can only visually inspect the inside of this unit. For a in-depth inspection a HVAC professional is recommended.

The window unit in the sunroom was not inspected by our company.

NI = Not Inspected

NP = Not Present

D = Deficient

NI NP D



B. Item 1(Picture)



B. Item 2(Picture)



B. Item 3(Picture)



B. Item 4(Picture)



B. Item 5(Picture)

lacktriangledown lac

Ductwork: Insulated **Filter Type:** Disposable

Comments:

The duct work was in good condition at the time of this inspection.

I NI NP D

There was a disposable filter present at the return air. The filter was in good condition and the grill cover was clean.



C. Item 1(Picture)

I NI NP D

IV. PLUMBING SYSTEM

□ □ □ ■ A. Plumbing Supply Distribution Systems and Fixtures

Location of water meter: Right Side

Location of main water supply valve: At the meter Static water pressure reading: 65 pounds/square inch

Water Source: Public

Plumbing Water Distribution (inside home): Copper

Comments:

There were missing back flow preventer on the exterior hose bibs.

Backflow preventers are small check valves that screw onto the ends of the exterior hose bibs. They prevent water from reversing flow back into the water lines if the city loses water pressure. These are required by City and State Standards.

Note: I was not able to determine the purpose of the PVC pipe that runs out of the left exterior wall and is buried.

Both washing machine valves leaks when off.



A. Item 1(Picture)



A. Item 2(Picture)



A. Item 3(Picture)



A. Item 4(Picture)

I NI NP D

□ □ □ ☑ B. Drains, Waste, and Vents

Plumbing Waste: PVC

Comments:

There was a chip in the master bathroom tub.

Note: The master bath tub access panel was not removable. The screws were starting to strip when attempting.



B. Item 1(Picture)

□ □ □ ▼ C. Water Heating Equipment

Energy Sources: Propane (quick recovery) **Capacity (Water Heater):** 40 Gallon (1-2 people)

Water Heater Manufacturer: Envirotemp
Water Heater Location: Closet, Utility Room

Comments:

This unit was operational at the time of this inspection.

The burn marks on the tank above the pilot light may indicate poor air flow.

The T&P (Temperature and Pressure) valve on water heater needs a 3/4 threaded pipe to extend within 6 inches of exterior ground for safety. (PVC is not approved for hot water use).

There is no pan under the unit. The pan should have a drainline attached running to the exterior. *This would not meet current building standards.*

This is a 1997 model. Most plumbers give a water heater a 10-15 year life.

The vent collar was not secured to the ceiling.

NI = Not Inspected


NP = Not Present

D = Deficient

I NINP D



C. Item 1(Picture)

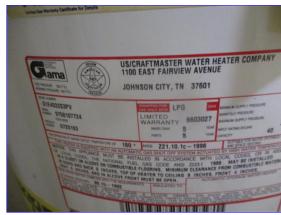

C. Item 2(Picture)



C. Item 3(Picture)



C. Item 4(Picture)



C. Item 5(Picture)



C. Item 6(Picture)

□ □ ☑ □ D. Hydro-Massage Therapy Equipment

Comments:

I = Inspected NI = Not Inspected **NP = Not Present** D = Deficient I NI NP D V. APPLIANCES □ □ □ ■ A. Dishwashers Comments: The unit was not disbursing water at the time of this inspection. The dishwasher drain line is below the sink drain. Current building standards require the dishwasher drain to be above the sink drain. This prevents the sink from draining back into the dishwasher drain line. Simple repair: just secure the drain line above the sink. □ □ ☑ □ B. Food Waste Disposers Comments: ☑ □ □ □ C. Range Hood and Exhaust Systems Comments: The venthood was operating at the time of this inspection. ✓ □ □ □ D. Ranges, Cooktops and Ovens Comments: The unit was operating at the time of this inspection. WITH IN 10 DEGREES D. Item 1(Picture) □ □ ☑ □ E. Microwave Ovens Comments: ☑ □ ☑ □ F. Mechanical Exhaust Vents and Bathroom Heaters Comments: There were windows in each bathroom for ventilation. Both bathroom electric heaters were operating at the time of this inspection. ☑ □ □ □ G. Garage Door Operator(s) Comments: The garage door will reverse when met with resistance.

Page 23 of 35

I = Inspected NI = Not Inspected NP = Not Present D = Deficient

I NI NP D

☑ □ □ H. Dryer Exhaust Systems

Comments:

The dryer vent was in good condition at the time of this inspection.

I = Inspected NI = Not Inspected NP = Not Present D = Deficient

I NI NP D

VI. OPTIONAL SYSTEMS

Comments:

The control panel was located in the utility room. The system was operating at the time of this inspection.

Not all of the zones were operating.

□ □ □ ■ A. Landscape Irrigation (Sprinkler) Systems

There was an active leak in the system located behind the home.

Recommend further review by a professional irrigation company.

There was not a rain delay sensor present. This would not meet current building standards.

This is a visual of the system. We do not inspect the buried water supply lines for leaks. Irrigation to yard coverage is not in the scope of this inspection.

NI = Not Inspected

NP = Not Present

D = Deficient

NI NP D



A. Item 1(Picture)



A. Item 2(Picture)



A. Item 3(Picture)



A. Item 4(Picture)



A. Item 5(Picture)

□ □ ■ B. Swimming Pools, Spas, Hot Tubs, and Equipment

Comments:

□ ☑ □ □ C. Outbuildings

Comments:

Our company did not inspect the outbuilding.

I = Inspected D = Deficient NI = Not Inspected **NP = Not Present** I NI NP D □ ☑ □ □ D. Private Water Wells (A coliform analysis is recommended) Comments: Our company did not inspect the well. □ ☑ □ □ E. Private Sewage Disposal (Septic) System Comments: Our company did not inspect the system system. □ □ ☑ □ F. Other Comments: □ □ ☑ □ G. Outdoor Cooking Equipment Comments: ☑ □ □ □ H. Gas Supply System Comments: The tank was located in the rear yard and was in good condition. **TANK 30% FULL** H. Item 2(Picture) H. Item 1(Picture) □ □ ☑ □ I. Whole-House Vacuum Systems

Comments:

Table of Contents

Cover Page	<u>1</u>
I STRUCTURAL SYSTEMS	5
II ELECTRICAL SYSTEMS	14
III HEATING, VENTILATION AND AIR CONDITIONING SYSTEMS	16
IV PLUMBING SYSTEM	
V APPLIANCES	23
VI OPTIONAL SYSTEMS	25
Table of Contents	28
Intro Page	29
General Summany	30

Date: 9/22/2021	Time:	Report ID:
Property:	Customer:	Real Estate Professional:
2 GLOCCOMORRA LANE	RYAN PATE	William Hartmann
HILL TOP LAKES TX 77871	CYLEIGH HOLLIDAY	KW

Comment Key or Definitions

The following are definitions of comment descriptions in this inspection report. All comments by the inspector should be considered before purchasing this home. Any recommendations by the inspector to repair or replace suggests a second opinion or further inspection by a qualified contractor. All costs associated with further inspection fees and repair or replacement of item, component or unit should be considered before you purchase the property.

Inspected (I) = I visually observed the item, component or unit and if no other comments were made then it appeared to be functioning as intended allowing for normal wear and tear.

Not Inspected (NI)= I did not inspect this item, component or unit and made no representations of whether or not it was functioning as intended and will state a reason for not inspecting.

Not Present (NP) = This item, component or unit is not in this home or building.

<u>Deficiency (D)</u> = The item, component or unit is not functioning as intended or needs further inspection by a qualified contractor. Items, components or units that can be repaired to satisfactory condition may not need replacement.

Standards of Practice:	Type of building:	In Attendance:
TREC Texas Real Estate Commission	Single Family (1 story)	Customer and their agent
Annuaring to any of buildings	T	Weather:
Approximate age of building:	Temperature:	weather:
Over 25 Years	Over 65 (F) = 18 (C)	Cloudy
Ground/Soil surface condition:	Rain in last 3 days:	Radon Test:
Damp	Yes	No
Water Test:		
No		

General Summary



Tucker Inspections

P.O. Box 10623 College Station, TX 77842 979.690.7211

> Customer RYAN PATE CYLEIGH HOLLIDAY

Address
2 GLOCCOMORRA LANE
HILL TOP LAKES TX 77871

The following items or discoveries indicate that these systems or components **do not function as intended** or **adversely affects the habitability of the dwelling**; or **warrants further investigation by a specialist**, or **requires subsequent observation**. This summary shall not contain recommendations for routine upkeep of a system or component to keep it in proper functioning condition or recommendations to upgrade or enhance the function or efficiency of the home. This Summary is not the entire report. The complete report may include additional information of concern to the customer. It is recommended that the customer read the complete report.

I. STRUCTURAL SYSTEMS

B. Grading and Drainage

Deficient

The soil is high along several areas of the foundation. It is recommended that at least three to four inches of slab is visible above the height of the grass or flower beds. Lack of slab exposure can lead to water and insect problems.

The foliage needs to be trimmed away from the structure.

Note: Recommend splash pads below the gutter downspouts to avoid erosion.

The gutters need to be cleaned out.

D. Roof Structures & Attics

Deficient

The attic framing in this home is typical for the era of its construction. It lacks enough bracing to meet current building standards. However, the framing still appears to be performing as intended with only signs of minor rafter deflection.

There was adequate insulation and ventilation present.

Recommend sistering (bracing) the rafters to the beams that have separated more than 1". These rafters have been sistered previously. It is this inspectors opinion with the lack of excessive settling evidence, the rafters were separated when the ridge vent was added.

E. Walls (Interior and Exterior)

Deficient

There was exterior trim decay in multiple areas around the unit.

There was loose/damaged vinyl siding in multiple areas around the unit.

There were moisture stains/decay along the base of the sunroom wall.

There were moisture stains along the base of the garage workroom wall.

Note: There was not a gap were the siding meets the roof. I am not able to visually see if flashing was installed. *This would not meet current building standards.*

There was peeling wall paper throughout the unit.

G. Doors (Interior and Exterior)

Deficient

The overhead garage door weather strip was torn/missing.

There was decay along the base of the garage workroom doors.

Note: The master bathroom door does not close to the jamb.

Note: There were multiple doors that rub the carpet when opening/closing. This makes it difficult to operate the doors.

I. Windows

Deficient

These are double pane insulated glass units. They were operational at the time of this inspection.

Screens: (3) Missing

Windows with broken seals: (20) Windows marked with blue tape. Included in the count was the garage rear window that was cracked.

The master bedroom windows were 44" or higher from the floor. This would not meet current building standards for Egress. Egress is the ability to escape directly from a bedroom to the outside in the event of a fire.

TREC standards of practice state an inspector only has to identify "insulated windows that are obviously fogged or display other evidence of broken seals." Tucker Inspections marks those windows found by the inspector to be broken or have bad seals with a blue piece of tape on the window during the course of the inspection. As a buyer it is recommended that you retain a company that can check all windows and give you a price to repair units found deficient. Tucker inspections does not guarantee that all windows with bad seals will be identified at the time of this inspection. We identify them the best we can.

J. Fireplaces and Chimneys

Deficient

This is a conventional unit that was found in acceptable condition at the time of this inspection.

There was not a damper blocker installed at the time of this inspection.

Current building standards require a damper blocker when gas logs are installed. This is a clamp or screw that prevents the damper from closing 100% to allow gas to escape in the event of a leak.

There was not a gas shut off valve near the gas log unit. I was not able to operate the gas logs at the time of this inspection.

K. Porches, Balconies, Decks and Carports

Deficient

The rear gazebo was in average/poor condition and in need of repair.

II. ELECTRICAL SYSTEMS

A. Service Entrance and Panels

Deficient

All components were found in satisfactory condition at the time of this inspection. The panel was labeled and located in the utility room.

There was not a main breaker present. This would not meet current building standards.

The main wire feed was double lugged. This is a safety hazard. Recommend further review by a professional electrician.

Note: The ground and bond wires were not separated on separate bars. Although common when this home was built, this would not meet current building standards.

B. Branch Circuits, Connected Devices, and Fixtures

Deficient

Not all of the bedrooms had a smoke detector present. Recommend installing detectors for safety.

There was not a labeled carbon monoxide detector outside of the sleeping areas.

Current building standards require a carbon monoxide detector to be installed outside all sleeping areas, in accordance with the manufacturer's installation instructions, in any home containing fuel-burning appliances or with an attached garage. Homeowners should consider installing CO detectors for safety. Ref 2009 IRC 315.

There were no fire protective covers over the closet light bulbs. This would not meet current building standards.

Current building standards require romex wire, that is not located in an attic, to be covered or in a conduit.

I am not able to operate exterior lights on solar sensor during the day,.

The dining room fan was not balanced. This means the unit wobbles when operating.

The doorbell was not operating at the time of this inspection.

There was not ground fault protected outlets in the required areas. This includes the exterior, kitchen, garage and bathrooms. Exception: The master bathroom outlet was GFCI.

Note: The garage ceiling fan was disconnected.

III. HEATING, VENTILATION AND AIR CONDITIONING SYSTEMS

A. Heating Equipment

Deficient

This unit was functioning properly at the time of this inspection.

The flexible gas line was run into the interior of the furnace. This is not allowed under current building standards. A piece of hard line gas pipe should have been used to enter the unit.

Smooth copper pipe was used to supply gas to the unit. This is no longer allowed as it is a safety hazard.

Note: We can only visually inspect the inside of this unit. For a in-depth inspection a HVAC professional is recommended.

B. Cooling Equipment

Deficient

The unit was operating at the time of the inspection. The degree differential between the register and return air should be between 15-20 degrees.

The differential was less than 15 degrees at the time of this inspection. **Recommend further review by a professional HVAC contactor.**

The T stat was difficult to operate and needs to be replaced.

The primary drain line is not insulated. This would not meet current building standards.

There are no locking cap valves on the Freon line on the exterior unit.

Note: We can only visually inspect the inside of this unit. For a in-depth inspection a HVAC professional is recommended.

The window unit in the sunroom was not inspected by our company.

IV. PLUMBING SYSTEM

A. Plumbing Supply Distribution Systems and Fixtures

Deficient

There were missing back flow preventer on the exterior hose bibs.

Backflow preventers are small check valves that screw onto the ends of the exterior hose bibs. They prevent water from reversing flow back into the water lines if the city loses water pressure. These are required by City and State Standards.

Note: I was not able to determine the purpose of the PVC pipe that runs out of the left exterior wall and is buried.

Both washing machine valves leaks when off.

B. Drains, Waste, and Vents

Deficient

There was a chip in the master bathroom tub.

Note: The master bath tub access panel was not removable. The screws were starting to strip when attempting.

C. Water Heating Equipment

Deficient

This unit was operational at the time of this inspection.

The burn marks on the tank above the pilot light may indicate poor air flow.

The T&P (Temperature and Pressure) valve on water heater needs a 3/4 threaded pipe to extend within 6 inches of exterior ground for safety. (PVC is not approved for hot water use).

There is no pan under the unit. The pan should have a drainline attached running to the exterior. *This would not meet current building standards.*

This is a 1997 model. Most plumbers give a water heater a 10-15 year life.

The vent collar was not secured to the ceiling.

V. APPLIANCES

A. Dishwashers

Deficient

The unit was not disbursing water at the time of this inspection.

The dishwasher drain line is below the sink drain.

Current building standards require the dishwasher drain to be above the sink drain. This prevents the sink from draining back into the dishwasher drain line. Simple repair: just secure the drain line above the sink.

VI. OPTIONAL SYSTEMS

A. Landscape Irrigation (Sprinkler) Systems

Deficient

The control panel was located in the utility room. The system was operating at the time of this inspection.

Not all of the zones were operating.

There was an active leak in the system located behind the home.

Recommend further review by a professional irrigation company.

There was not a rain delay sensor present. This would not meet current building standards.

This is a visual of the system. We do not inspect the buried water supply lines for leaks. Irrigation to yard coverage is not in the scope of this inspection.

Home inspectors are not required to report on the following: Life expectancy of any component or system; The causes of the need for a repair; The methods, materials, and costs of corrections; The suitability of the property for any specialized use;

Compliance or non-compliance with codes, ordinances, statutes, regulatory requirements or restrictions; The market value of the property or its marketability; The advisability or inadvisability of purchase of the property; Any component or system that was not observed; The presence or absence of pests such as wood damaging organisms, rodents, or insects; or Cosmetic items, underground items, or items not permanently installed. Home inspectors are not required to: Offer warranties or guarantees of any kind; Calculate the strength, adequacy, or efficiency of any system or component; Enter any area or perform any procedure that may damage the property or its components or be dangerous to the home inspector or other persons; Operate any system or component that is shut down or otherwise inoperable; Operate any system or component that does not respond to normal operating controls; Disturb insulation, move personal items, panels, furniture, equipment, plant life, soil, snow, ice, or debris that obstructs access or visibility; Determine the presence or absence of any suspected adverse environmental condition or hazardous substance, including but not limited to mold, toxins, carcinogens, noise, contaminants in the building or in soil, water, and air; Determine the effectiveness of any system installed to control or remove suspected hazardous substances; Predict future condition, including but not limited to failure of components; Since this report is provided for the specific benefit of the customer(s), secondary readers of this information should hire a licensed inspector to perform an inspection to meet their specific needs and to obtain current information concerning this property.

Prepared Using HomeGauge http://www.HomeGauge.com: Licensed To Tom Rike